




## Unity 1 Installation Instructions

### 1) For clamp mount:


Adjust clamp to proper  
Work surface thickness

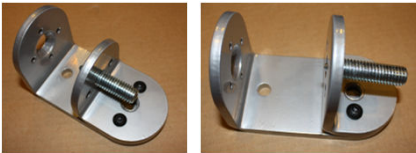

Use shorter silver bolt to  
attach clamp to riser.  
Peel and stick black  
rubber pad to protect  
work surface



Tighten bolt firmly, making sure  
to insert bottom thick washer  
between top of bolt and  
underside of work surface

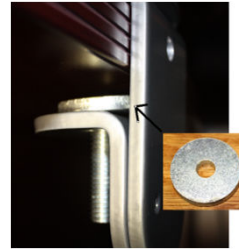

### 1) For grommet mount:

Use longer black bolt and  
rectangular  
bottom plate. Screw long  
bolt in  
from under work surface  
up into riser



### 2) Insert gas arm:



### 3) Insert extension arm:



### 4) Attach monitor to vesa mount:



### 5) Insert vesa into extension arm:




### 6) Adjust gas spring tension:



If monitor sinks, turn  
counterclockwise.  
If monitor rises, turn  
clockwise. Set so  
monitor stays in any  
position.

### 7) Gently tighten set the 3 screws:

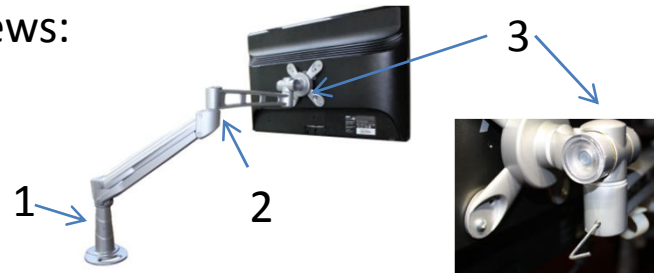

### 8) Insert cable managers:

